


# Smoke and Dye Testing Summary

## High Level Sewershed

### Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Nearest MH	Ground Condition	Notification Made?		
D1028-169	Dye	4/28/2009	ADS/TM	S11GG_021MH	Dry	NA		
Address	1603 Bloomingdale Road		Location	Paved asphalt	Status	Public	Source	Storm Manhole

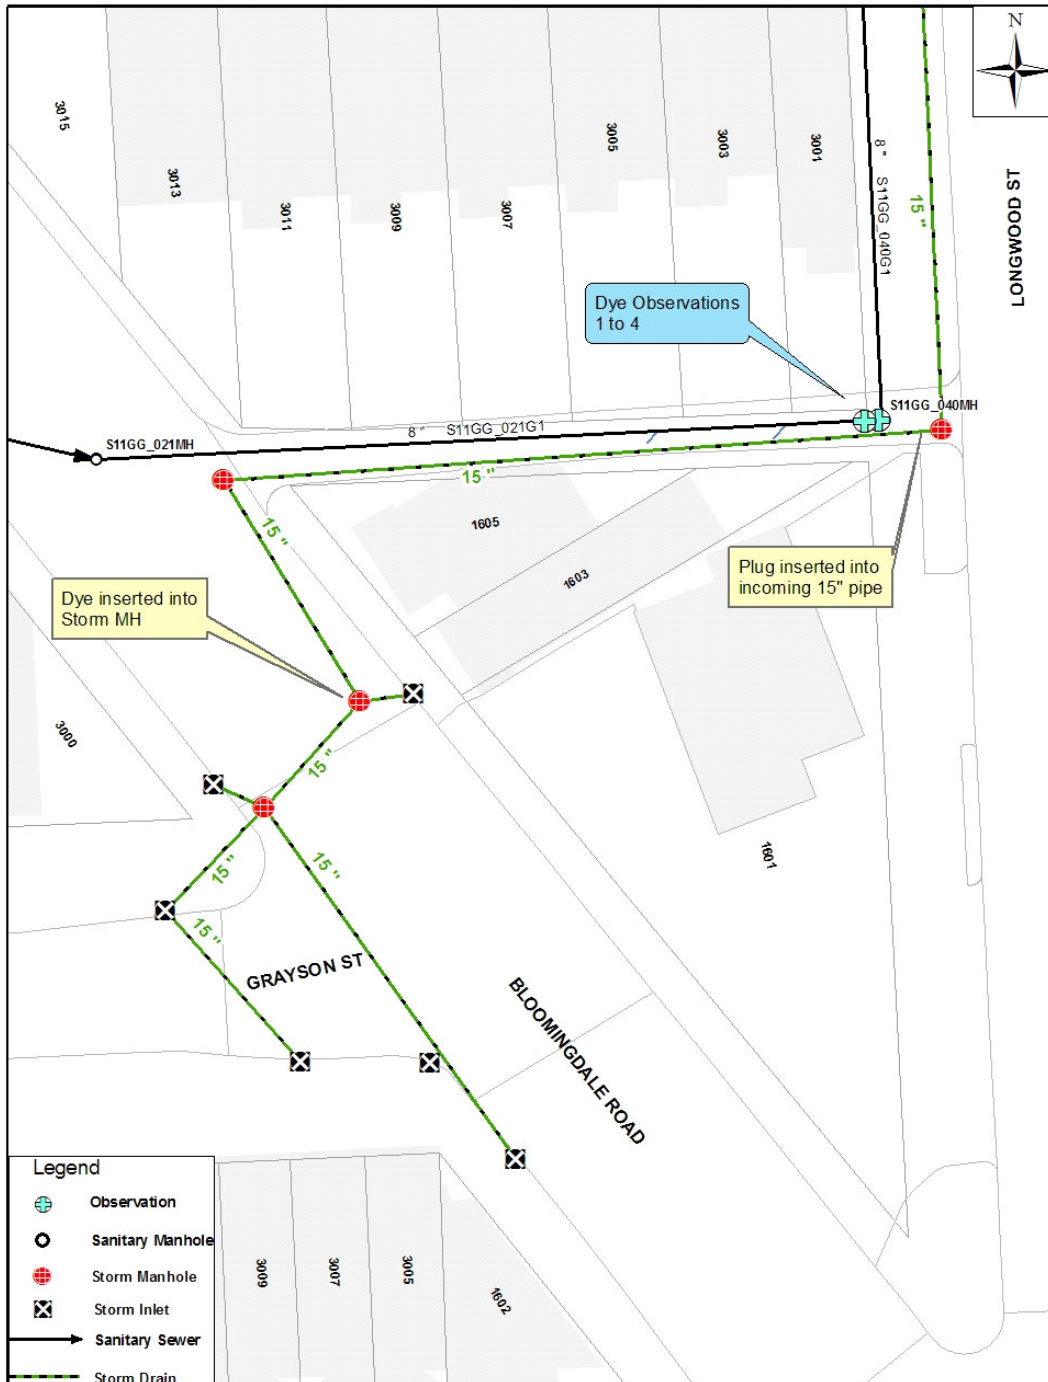

---

# Smoke and Dye Testing Summary

---

## High Level Sewershed

### Run Summary

Run Summary							
Test ID	Test Type	Date Inspected	Company / Super.	Nearest MH	Ground Condition	Notification Made?	
D1028-169	Dye	4/28/2009	ADS/TM	S11GG_021MH	Dry	NA	
Address	1603 Bloomingdale Road		Location	Paved asphalt	Status	Public	Source Storm Manhole

### Observations & Photos

**Obs\_ID** D1028-169-OB01

**Nearest MH** S11GG\_040MH

**Comments** Dye observed 147.4 ft. downstream of S11GG\_021MH. Infiltration runner at joint at 5 o'clock.



**Picture** \D1028-169-OB01-P01.jpg

**Comments** 147.4 ft. downstream of S11GG\_021MH along S11GG\_021G1.

---

**Obs\_ID** D1028-169-OB02

**Nearest MH** S11GG\_040MH

**Comments** Dye observed 147.4 ft. downstream of S11GG\_021MH. Infiltration runner at joint at 7 o'clock.



**Picture** \D1028-169-OB02-P01.jpg

**Comments** 147.4 ft. downstream of S11GG\_021MH along S11GG\_021G1.

---

---

# Smoke and Dye Testing Summary

---

## High Level Sewershed

### Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Nearest MH	Ground Condition	Notification Made?
D1028-169	Dye	4/28/2009	ADS/TM	S11GG_021MH	Dry	NA

<b>Address</b>	1603 Bloomingdale Road	<b>Location</b>	Paved asphalt	<b>Status</b>	Public	<b>Source</b>	Storm Manhole
----------------	------------------------	-----------------	---------------	---------------	--------	---------------	---------------

**Obs\_ID** D1028-169-OB03

**Obs\_ID** D1028-169-OB04

**Nearest MH** S11GG\_040MH

**Nearest MH** S11GG\_040MH

**Comments** Dye observed in bench of S11GG\_040MH.

**Comments** Dye observed from pipe in wall of S11GG\_040MH.  
Possible connection of storm drain to sanitary sewer.



**Picture** \D1028-169-OB03-P01.jpg

**Comments** At manhole S11GG\_040MH.



**Picture** \D1028-169-OB04-P01.jpg

**Comments** Pipe in wall of manhole S11GG\_040MH.